

TSB # 625-0043
Prince Castle
355 East Kehoe Blvd
Carol Stream, IL 60188
Date 7/7/17

Dear Customer,

In a going effort to ensure quality on our Genuine OEM Equipment, we are Issuing a Technical Service Bulletin for our 625-MFY Series Steamers. This Bulletin will indicate new product time changes to accommodate for new bread product, along with silicone tube (OEM PART # 625-359S) replacement and proper regulator pressure to ensure Gold Standard Product. **Please note this programming change and PM is not covered under any Prince Castle OEM Warranty.**

Setting Changes:

- New Setting changes needed for new Bread Product. Please follow the programming procedures to adjust to new McDonald's settings for US models only.

Model #'s effected:

- 625-MFY (All Serial #'s)
- 625-MFYC (All Serial #'s)

Procedure:

Follow Video Instructions below to change to the new settings listed below.

Old Settings
0.5 sec on
1.0 sec off
6 Cycles
2.5 alarm

New Settings
.6 sec on
2.5 sec off
1 Cycle
2.5 alarm




TSB # 625-0043
Prince Castle
355 East Kehoe Blvd
Carol Stream, IL 60188
Date 7/7/17

Adjusting Regulator PSI on older model steamers:

****Please note some steamers have locked settings that can't be adjusted****



****Proper Regulator PSI Range = 20-30psi****

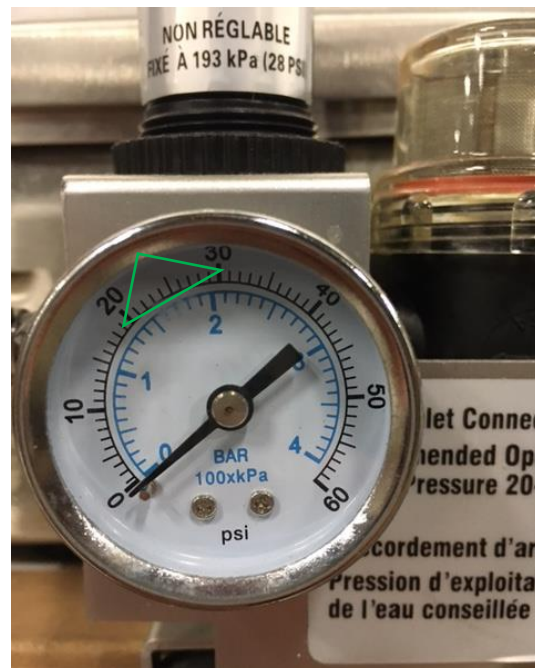

Adjusting Regulator PSI on older MFY models:

Step #1:

- Push down and twist regulator clockwise and counter clockwise until desired pressure is displayed.



Step # 2:

- Push down on top of regulator adjuster to reset it into a locked position.



TSB # 625-0043
Prince Castle
355 East Kehoe Blvd
Carol Stream, IL 60188
Date 7/7/17



Sincerely,

A handwritten signature in black ink, appearing to read "Paul Svenningsen", with a long horizontal flourish extending to the right.

Paul Svenningsen

Technical Service Manager U.S.